CM 42 OPERATING INSTRUCTIONS Translation of the original instructions





VERS. 2015.07.06



CE Declaration of conformity

The undersigned manufacturer:

SAINT - GOBAIN ABRASIVES S.A. 190, BD J.F. KENNEDY L- 4930 BASCHARAGE

Declares that this product: Masonry Saws: CM 42 115V UK CM 42 230V UK CM 42 230V

Code: 70184647990 70184647989 70184647620

is in conformity with the following Directives:

- "MACHINES" 2006/42/CE
- "LOW VOLTAGE" 2006/95/CE
- "ELECTROMAGNETIC COMPATIBILITY" 2004/108/CE
- "NOISE" 2000/14/CE

and European standard:

• EN 12418 – Masonry and stone cutting-off machines – Safety

Valid for machines as of serial number: 130400000

Storage site for the technical documents : Saint-Gobain Abrasives 190, Bd. J. F. Kennedy 4930 BASCHARAGE, LUXEMBOURG

This declaration of conformity loses its validity when the product is converted or modified without agreement.

Bascharage, Luxembourg, 01.04.2013

Olivier Plenert, executive officer.

CM 42 OPERATING INSTRUCTIONS TABLE OF CONTENTS

| <u>1</u> | BASIC SAFETY INSTRUCTIONS | 5 |
|------------|---|----|
| 1.1 | Symbols | .5 |
| 1.2 | - | |
| 1.3 | Safety instructions for particular operating phases | 6 |
| <u>2</u> | MACHINE DESCRIPTION | 7 |
| 2.1 | Short description | .7 |
| 2.2 | Purpose of use | .7 |
| 2.3 | Layout | .7 |
| 2.4 | - | |
| 2.5 | Statement regarding the vibration emission | 10 |
| 2.6 | Statement regarding noise emission1 | 11 |
| <u>3</u> | ASSEMBLY AND COMMISSIONING1 | 2 |
| 3.1 | Tool assembly | |
| 3.2 | • | |
| 3.3 | • | |
| 3.4 | | |
| 3.5 | • | |
| 4 | TRANSPORT AND STORING | |
| <u> </u> | Securing for transport | _ |
| 4.1 4.2 | | |
| | | |
| 4.3 | | |
| <u>5</u> | OPERATING THE MACHINE1 | 5 |
| 5.1 | Site of work1 | 15 |
| 5.2 | Cutting methods1 | 15 |
| <u>6</u> | MAINTENANCE AND SERVICING1 | 7 |
| <u>7</u> | FAULTS : CAUSES AND CURES1 | 8 |
| 7.1 | Fault-finding procedures | 18 |
| 7.2 | | |
| 7.3 | | |
| 7.4 | Customer service2 | 21 |

1 BASIC SAFETY INSTRUCTIONS

The CM 42 is exclusively designed for the cutting of construction products mainly on construction sites.

Uses other than the manufacturer's instructions shall be considered as contravening the regulations. The manufacturer shall not be held responsible for any resulting damage. Any risk shall be borne entirely by the user. Observing the operating instructions and compliance with inspection and servicing requirements shall also be considered as included under use in accordance with the regulations.

1.1 Symbols

Important warnings and pieces of advice are indicated on the machine using symbols. The following symbols are used on the machine:





Ear protection must be worn



Hand protection must be worn




Eye protection shall be worn



Rotation direction of the blade



1.2 Machine plate

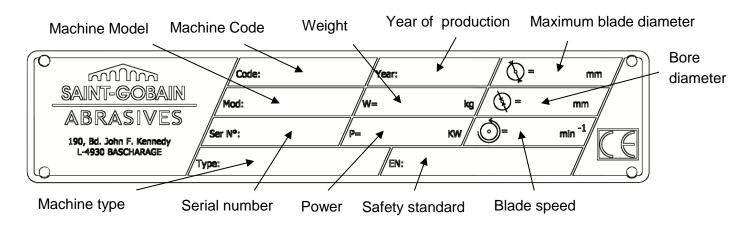

Important data can be found on the following plate located on the machine:

1.3 Safety instructions for particular operating phases

Before commencing work

- Before commencing work, make yourself familiar with the working environment at the place of use. The working environment includes: obstacles in the area of work and manoeuvre, the firmness of the floor, necessary protection at the site relating to public thoroughfares and the availability of help in the event of accidents.
- Check for correct mounting of the blade regularly.
- Immediately remove damaged or badly worn blades, as they endanger the operator whilst rotating.
- Only fit NORTON diamond blades to the machine! The use of other tools can damage the machine!
- Attention is drawn to the use of BS2092 safety goggles in conformity with specified Processes No.8 of the Protection of Eyes Regulation 1974, Regulation 2(2) Part 1.
- Use of ear and hand protection is compulsory.
- For security reasons, never leave the machine unattended, untied or unlocked.

While the engine is running

- Do not move the machine whilst the blade is running idle.
- Always cut with the blade guard in position.

2 MACHINE DESCRIPTION

Any modification, which could lead to a change in the original characteristics of the machine, may be done only by Saint-Gobain Abrasives who shall confirm that the machine is still in conformity with the safety regulations.

2.1 Short description

The CM 42 Masonry saw is designed for durability and high performance for onsite wet and dry cutting operations of a wide range of masonry, refractory and natural stone products. As with all other CLIPPER products, the operator will immediately appreciate the attention given to detail and quality of materials used in construction. The machine and its component parts are assembled to high standards assuring long life and minimum maintenance.

2.2 Purpose of use

The machine is designed for wet and dry cutting of a large range of building and refractory materials, or tiles. It is not designed for cutting wood or metals.

2.3 Layout



Frame and feet (1)

The frame is made of a jig-welded reinforced steel construction to ensure perfect rigidity. 4 removable legs fit into housings welded on frame sides and locked into place with wing screws. The front feet are adjustable. It is also equipped with wheels and handles for transportation.

Cutting head (2)

Spring loaded jig-welded steel console. The motor fixing points and the pivot are machined for perfect fit. A locking system allows straight-through cutting without any other accessory.

Blade guard (3)

Jig-welded steel construction with 400mm-diameter blade capacity, which offers maximum operator protection and increased visibility of the work piece.

Incorporated in the blade guard is an outer metal cover, which can be easily removed to allow easy access to shaft for inspection and blade replacement when motor is switched off, while fully protecting the blade when in operation.

Electrical motor (4)

2.2 kW (1.8 kW for 115V) electrical motor with an overload protection. Low voltage trigger (NVR) built in the switch prevents the motor to restart for example after a power cut. Thermal overload tripping can occur for two reasons:

a) Tripping under light load if connection is incorrect

b) Tripping under heavy load if motor has been overloaded.

The ON-OFF switch also serves as emergency stop.

Conveyor cart (5)

Steel welded construction with non-slip top. As an accessory, a conveyor can tilt from 0 to 45° for angle bevel tile cutting.

The machine guide system permits precise cuts to be made by virtue of four roller sheaves set at an inclination to compensate for wear. The nylon-plastic sheaves and sealed-bearings permit easy operation. Precise positioning of the material is possible thanks to the large surface area of the conveyor cart and the variable angle guide-a-cut. The table has an anti-dumping system and a locking latch.

Water cooling system (6)

The coolant system comprises:

- A powerful, submersible electric water pump.
- Plastic suction pipe delivering the water from the water pan to the cutting head.
- A large capacity water pan supplied with drain plug.
- A water-tap, fitted to the blade guard, permitting controlled water flow.
- Two water nozzles located on the blade guard ensure adequate flow of water to both sides of the cutting blade.
- A water curtain, fixed to head axle restricts water spray and minimizes water loss.
- The pump switch is located on the right side of the main switch.

Attention: The water pump must never run without water.

2.4 Technical data

| Electric motor | 1,8 kW 115V with thermal overload protection 2,2 kW 230V with thermal overload protection | | | |
|--|--|--|--|--|
| Electric motor protection | IP54 | | | |
| Max. blade diameter | 400mm | | | |
| Bore | 25,4mm | | | |
| Rotation speed of the blade | 2800 min ⁻¹ | | | |
| Flange diameter | 135mm (without reversing the material) | | | |
| Cutting depth mm | 90mm | | | |
| Sound pressure level | 80 dB (A) (ISO EN 11201) | | | |
| Sound energy level | 92 dB (A) (ISO EN 3744) | | | |
| Max. cutting length mm | 600mm | | | |
| Table dimension (L x W) | 500x540mm | | | |
| Machine dimensions feet folded (L x W x H) | 1187x741x729mm | | | |
| Machine dimensions feet unfolded (L x W x H) | 1187x741x1355mm | | | |
| Weights: | | | | |
| Fully equipped | 90 kg | | | |
| Ready for use (with water) | 132 kg | | | |

2.5 Statement regarding the vibration emission

Declared value of vibration emission following EN 12096.

| Machine Model / code | Measured value of vibration emission at m/s ² | Uncertainty K m/s ² | Tool used Model / code |
|-------------------------------------|---|-----------------------------------|---------------------------|
| CM 42 | | | |
| 115V UK | | | |
| 70184647990 | | | |
| CM 42 230V UK 70184647989 | <2.5 | 0.5 | Clipper ALFA |
| CM 42 230V | | | |
| 70184647620 | | | |

- The vibration value is lower and does not exceed 2.5 m / s.
- Values determined using the procedure described in the standard EN 12418.
- The measurements are made with new machines. Actual values may vary with site conditions, in terms of:
 - Materials worked
 - ➢ Wear Machine
 - Lack of maintenance
 - Inappropriate tool for application
 - > Tool in poor condition
 - Unskilled operator
 - ➢ Etc…
- The exposure time to vibration is based on the performance of work (related to the adequacy Machine / Tool / worked material / operator)

When evaluating risks due to hand-arm vibration, you need to take into account effective usage at rated power of machine during a full day of work; quite often you will realise that effective utilisation time represents around 50% of overall duration of work. You have to consider, of course, breaks, water feeding, preparation of work, time to move the machine, disk mounting...

2.6 Statement regarding noise emission

Declared value of noise emission following EN ISO 11201 and NF EN ISO 3744.

| Machine Model / code | Sound Pressure level L _{Peq} EN ISO 11201 | Uncertainty K (Sound Pressure level L _{Peq} EN ISO 11201) | Sound power level L _{weq} NF EN ISO 3744 | Uncertainty K (Sound power level L _{weq} NF EN ISO 3744) |
|---|---|--|--|--|
| CM 42 115V UK 70184647990 | | | | |
| CM 42 230V UK 70184647989 CM 42 230V 70184647620 | 80 dB(A) | 2.5 dB(A) | 92 dB(A) | 4 dB(A) |

- Values determined using the procedure described in the standard **EN 12418**.
- The measurements are made with new machines. Actual values may vary with site conditions, in terms of:
 - > Wear Machine
 - Lack of maintenance
 - Inappropriate tool for application
 - > Tool in poor condition
 - Unskilled operator
 - ➤ Etc...
- Measured values relate to an operator in normal use, as described in the manual position.

3 ASSEMBLY AND COMMISSIONING

The machine is delivered fully equipped (although without diamond blade). It is ready for operation when you mount the diamond blade, the handles and the conveyor cart and after you connect to the appropriate power supply.

3.1 Tool assembly

Only NORTON blades with a maximum diameter of 400 mm can be used with the CM 42.

All tools used must be selected with regard to their maximum permitted cutting speed for the machine's maximum permitted rotation speed. Before mounting a new blade into the machine, switch off the machine and isolate it from the main source of electricity.

To mount a new blade, follow these steps:

- Loosen the screw in front of the blade guard and disconnect the water hose on its the left side and open it.
- Loosen the hexagonal nut on the blade shaft (**attention:** left threaded), which holds the removable outer flange, with the supplied wrench.
- Remove the outer flange.
- Clean the flanges and blade shaft and inspect for wear.
- Mount the blade on arbour ensuring that direction of rotation is correct. Wrong direction of rotation blunts the blade quickly.
- Replace outer blade flange.
- Tighten the hexagonal (attention: left threaded), nut with the supplied wrench.
- Close the blade guard, retighten the screw on the front of the blade guard and reconnect the water hose.

ATTENTION: The blade bore must correspond exactly to the diameter of the blade shaft. Cracked or damaged bore is dangerous for the operator and for the machine.

3.2 Implementation of elements

The machine is delivered with its transportation handles disassembled. You have to mount these handles thanks to the 4 supplied M10x25 crews.

The cutting head is locked in low-position by a hexagonal nut. Replace it by the supplied tension lever.

On the left side of the machine, feet are locked in their folded position by nuts. Replace them by the supplied tension levers then unfold the feet and lock them with the tension levers.

3.3 Electrical connections

Check that,

- The voltage/phase supply corresponds to the information indicated on the motor plate.
- Available power supply must have ground connection in conformity with safety regulations.
- The connecting cables should have at least a 2. 5mm²-section per phase.

3.4 Starting the machine

Open the cover on the switch and press the green button to start the machine. Either press on the red button or directly on the switch cover to stop the machine.

3.5 Water cooling system

- Fill the water pan with clean water to approximately 2cm from top (ensure that bottom of pump is fully immersed in water). Use the pump switch on the side of the main switch to start the pump.
- Open the water-tap on blade guard (note that handle on water-tap should be in line with water-flow).
- Ensure that water is flowing freely in the circuit and is delivered adequately to both sides of the blade, as insufficient water supply may result in premature failure of the diamond blade.
- The water pump must never run without water. Always make sure that there is enough water in the pan and refill if necessary.
- In case of frost, empty the water cooling system from its water.

4 TRANSPORT AND STORING

4.1 Securing for transport

Before transporting the machine, always remove the blade and empty the water pan. Lock the conveyor thanks to the latch.

4.2 Transportation procedure

There are two ways to move the machine: By one person, its feet folded and making use of the transport wheels, our by two persons with its feet folded our unfolded.

Always fold the feet while transporting the machine in a van our truck.

The machine does not have lifting hooks.

4.3 Long period of inactivity

If the machine is not going to be used for a long period, please take the following measures:

- Completely clean the machine
- Empty the water system
- Take the water pump out of the slurry and clean it thoroughly.

The storage site must be clean, dry and at a constant temperature.

5 OPERATING THE MACHINE

You will find in this chapter some advice about where and how to put up the machine.

5.1 Site of work

- 5.1.1 Siting the machine
- Remove from the site anything, which might hinder the working procedure!
- Make sure the site is sufficiently well lit!
- Observe manufacturer's conditions for connecting to power supplies!
- Place electric cables in such a way that damage is excluded!
- Make sure you have a continual adequate view of the working area so you can intervene in the working process at any time!
- Keep other staff out of the area, so you can work securely.


5.1.2 Area dedicated for the use and maintenance of the machine

You should have 2 m in front of the machine and 1,5 m on both sides to get a comfortable use of the machine.

5.2 Cutting methods

To use the machine correctly, you must face it with one hand on the handle of the cutting head, and the other on the conveyor cart. Always keep your hands away from the moving blade. Open the switch cover and press the green button to start the machine. To stop either use the red button or press directly on the switch front cover.

5.2.1 Full depth or fixed cutting

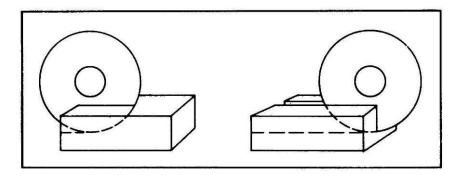

In full depth or fixed cutting, the cutting head is locked in a fixed position and the material is pushed into it as shown.


- Lower the cutting head to the desired cutting depth (in "through cutting", lower cutting head until blade periphery reaches max. 3mm under the surface of the conveyor cart) by means of the handle on the blade guard
- Fix position by tightening the clamping device
- Put material on conveyor cart
- Start the machine

VERS. 2015.07.06

• Push the conveyor cart slowly and without undue pressure towards the rotating blade and cut the material as shown on the picture.

NOTE: While recommended, it is not absolutely necessary to lock the cutting head into a given depth position when jam cutting. The desired cutting depth can be maintained by holding firmly the depth feed handle on the blade guard. If the full depth of cut requires excessive pressure (on very dense material e.g.) make 2 or 3 shallow cuts.

5.2.2 Multiple step cutting

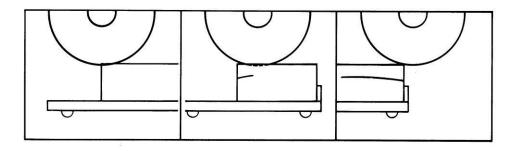

Multiple step cutting consists of moving the conveyor cart with the material to be cut back and forward under the rotating blade,

- Place the material to be cut on the conveyor cart firmly against the guide-a-cut and the backstop, keeping the hands well away from the blade.
- Start the machine.
- Move conveyor cart forward near the blade and pull down the cutting head until blade is lowered to a point where it will lightly contact the surface of the material.
- Pass the material beneath with rapid full length strokes, taking a shallow cut (approximately 3 mm deep as shown on the picture) on the forward. On the backward stroke, lift the blade just clear over the cutting line.
- Complete each rapid stroke backward and forward by passing the material beyond the centre of the blade before starting the reverse movement of the conveyor cart.

NOTE: the harder the material, the more rapid should be the forward and backward strokes.

Step cutting lessens the area of the blade circumference in contact with the material, keeping the blade cool, running free and cutting at peak efficiency.

5.2.3 General advice for the cutting

- Material weight under 30 kg and having dimensions smaller than 600x600x135mm can be cut with the machine.
- Before commencing work make sure tools are firmly seated!
- Select the right tools as recommended by the manufacturer depending on the material to be worked, the working procedure (dry or wet cut) to be carried out and the required efficiency.
- Apply cooling water continuously whilst cutting and in good time! Make sure the water pan contains enough water.
- In case the thermal protection trips, wait until the motor has cooled down before starting the machine again.

6 MAINTENANCE AND SERVICING

To ensure a long-term quality from the cutting with the CM 42, please follow the maintenance plan below :

| | | At the beginning of a working day | During the change of tool | At the end of a working day | Every week | After a fault | After a damage |
|---------------------------------|--|-----------------------------------|---------------------------|-----------------------------|------------|---------------|----------------|
| Whole machine | Visual control (general aspect, water tightness) | | | | | | |
| | Clean | | | | | | |
| Flange and blade fixing devices | Clean | | | | | | |
| Motor cooling fans | Clean | | | | | | |
| Water pump | Clean | | | | | | |
| Water pan | Clean | | | | | | |
| Water tank | Clean | | | | | | |
| Water hoses and nozzles | Clean | | | | | | |
| Water pump filter | Clean | | | | | | |
| Cart guiding bars | Clean | | | | | | |
| Motor housing | Clean | | | | | | |
| Reachable nuts and screws | Tighten | | | | | | |

Maintenance of the machine

Always perform the maintenance of the machine with the machine isolated from the electrical supply.

Lubrication

The CM 42 uses life-lubricated bearings. Therefore, you don't need to lubricate the machine at all.

Cleaning of the machine

Your machine will last longer if you clean it thoroughly after each day of work, especially water pump, water pan (which can be removed for easy cleaning), motor and blade flange.

7 FAULTS : CAUSES AND CURES

7.1 Fault-finding procedures


Should any fault occur during the use of the machine, turn it off, and isolate it from the electrical supply. Any works dealing with the electrical system or supply of the machine can only be carried out by a qualified electrician.

7.2 Trouble-shooting guide


| Trouble | Possible source | Resolution | | | | |
|---|---|---|--|--|--|--|
| | No electricity | Check the electrical supply (fuse for example) | | | | |
| | Connection cable section too small | Change connection cable | | | | |
| Motor is not running | Defective switch | CAUTION : can only be solved by a qualified electrician | | | | |
| | Defective motor | Change motor or contact motor manufacturer | | | | |
| | Defective connection cable | Change connection cable | | | | |
| | Cutting advance too quick | Cut slowly | | | | |
| Motor stops during the cutting, but can be | Blade is blunt or glazed | Sharpen the blade every 10- 15 cuts in calcareous stone | | | | |
| restarted after a short | Defective blade | Change blade | | | | |
| period (overload protection) | Wrong blade specification for the application | Change blade | | | | |
| | Not enough water in the pan | Refill the water pan | | | | |
| | Water supply system is blocked up | Clean water supply system | | | | |
| No water on the blade | Water pump is not working | Prime the pump or reactivate the switch CAUTION : if switch trips again, problem only be solved by a qualified electrician | | | | |

7.3 Circuit diagram

115V

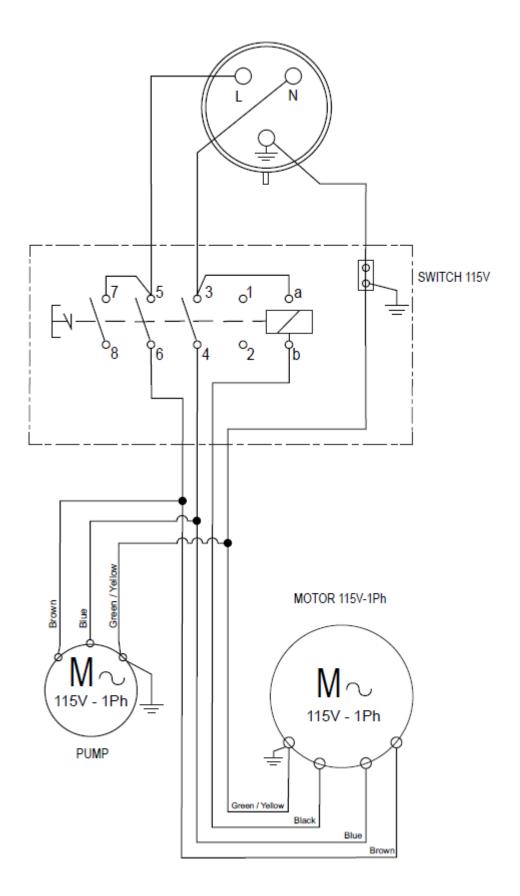

230V

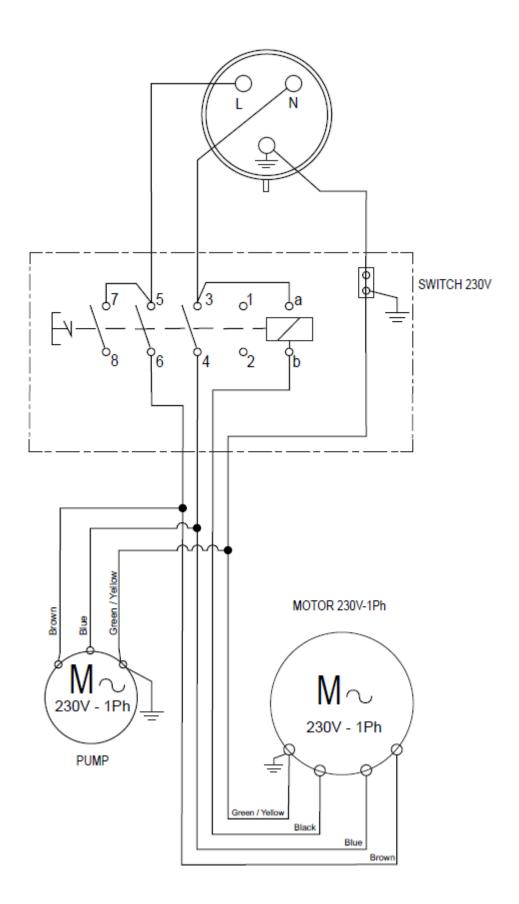

7.4 Customer service

When ordering spare parts, please mention:

- The serial number (7 digits).
- The code of the part.
- The exact denomination.
- The number of parts required.
- The delivery address.
- Please indicate clearly the means of transportation required such as "express" or "by air". Without specific instructions, we will forward the parts through the means which seem appropriate to us --- but which is not always the quickest way.

Clear instructions will avoid problems and faulty deliveries.

If not sure, please send us the defective part.

In the case of a warranty claim, the part must always be returned for evaluation.

Spare parts for the motor can be ordered with the manufacturer of the motor or with their dealer, which is often quicker and cheaper.

This machine has been manufactured by: Saint-Gobain Abrasives S.A.

190, Bd. J. F. Kennedy L- 4930 BASCHARAGE Grand-duché de Luxembourg. Tel.: 00352-50 401-1 Fax: 00352- 50 16 33 http://www.construction.norton.eu e-mail: sales.nlx@saint-gobain.com Guarantee can be claimed and technical support obtained from your local distributor where machines, spare parts and consumables can be ordered as well:

SAINT-GOBAIN ABRASIVES NV/SA INDUSTRIELAAN 129 1070 ANDERLECHT/BRUSSEL BELGIUM TEL: +32 (0)2 267 21 00 FAX: +32 (0)2 267 84 24

SAINT-GOBAIN ABRASIVES, S.R.O. POČERNICKÁ 272/96, MALEŠICE 108 00 PRAHA 10 CZECH REPUBLIC TEL: +420 255 719 326 FAX: +420 255 719 321

SAINT-GOBAIN ABRASIVES A/S ROBERT JACOBSENS VEJ 62A 2300 KØBENHAVN S DENMARK TEL: +45 4675 5244

PO BOX 643706 FORTUNE TOWER OFFICE 2106 JLT BLOCK C (NEXT TO METRO STATION) JUMEIRA LAKE TOWER, DUBAI UNITED ARAB EMIRATES TEL: +971 4 431 5154 FAX: +971 4 431 5434

SAINT-GOBAIN ABRASIFS RUE DE L'AMBASSADEUR - B.P.8 78 702 CONFLANS CEDEX FRANCE TEL: +33 [0]1 34 90 40 00 FAX: +33 [0]1 39 19 89 56

SAINT-GOBAIN ABRASIVES GMBH BIRKENSTRASSE 45-49 D-50389 WESSELING GERMANY TEL: +49 (0) 2236 703-1 +49 (0) 2236 8996-0 +49 (0) 2236 8911-0 FAX: +49 (0) 2236 703-367 +49 [0] 2236 8996-10 +49 (0) 2236 8911-30 FÜR DEN FACHHANDEL ÖSTERREICH TEL: +43 (00) 662 430 076 SAINT-GOBAIN ABRASIVES KFT. 1225 BUDAPEST BÁNYALÉG U. 60/B. HUNGARY

TEL: +36 1 371 22 50 FAX: +36 1 371 22 55 SAINT-GOBAIN ABRASIVI S.P.A VIA PER CESANO BOSCONE 4 I-20094 CORSICO MILANO ITALY TEL: +39 02 44 851 FAX: +39 02 44 78 266

SAINT-GOBAIN ABRASIVES S.A. 190 RUE J.F. KENNEDY L-4930 BASCHARAGE GRAND DUCHE DE LUXEMBOURG TEL: +352 50 401 1 FAX: +352 50 16 33 NO. VERT (FRANCE) 0800 906 903

SAINT-GOBAIN ABRASIFS, S.A. 2 ALLÉE DES FIGUIERS AIN SEBAÂ - CASABLANCA MOROCCO TEL: +212 5 22 66 57 31 FAX: +212 5 22 35 09 65

SAINT-GOBAIN ABRASIVES BV GROENLOSEWEG 28 7151 HW EIBERGEN P.O. BOX 10 7150 AA EIBERGEN THE NETHERLANDS TEL: +31 545 466466 FAX: +31 545 474605

SAINT-GOBAIN ABRASIVES AS POSTBOKS 11, ALNABRU, 0614 OSLO BROBEKKVEIEN 84, 0582 OSLO NORWAY TEL: +47 63 87 06 00 FAX: +47 63 87 06 01

SAINT-GOBAIN HPM POLSKA SP. Z 0.0. UL. NORTON 1 62-600 KOŁO POLAND TEL: +48 63 26 17 100 FAX: +48 63 27 20 401

SAINT-GOBAIN ABRASIVOS, L. DA ZONA INDUSTRIAL DA MAIA I-SECTOR VIII, NO. 122 APARTADO 6050 4476 - 908 MAIA PORTUGAL TEL: +351 229 437 940 FAX: +351 229 437 949 SAINT-GOBAIN GLASS BUSINESS UNIT ABRASIVI PUNCT DE LUCRU: LOC.VETIS, JUD. SATU MARE 447355 STR. CAREIULUI 11 PARC INDUSTRIAL RENOVATIO ROMANIA TEL: 0040-261-839.709 FAX: 0040-261-839.710

SG HPM RUS 58, F. ENGELS STR. STROENIE 2 105082 MOSCOW RUSSIA TEL: +74 955 408 355 FAX: +74 959 373 224

SAINT-GOBAIN ABRASIVES (PTY) LTD 2 MONTEER ROAD ISANDO 1600 P.O. BOX 67 SOUTH AFRICA TEL: +27 11 961 2000 FAX: +27 11 961 2184/5

SAINT-GOBAIN ABRASIVOS, S.A. CTRA. DE GUIPÚZCOA, KM. 7,5 E-31195 BERRIOPLANO (NAVARRA) SPAIN TEL: +34 948 306 000 FAX: +34 948 306 042

SAINT-GOBAIN ABRASIVES AB BOX 495 SE-191 24 SOLLENTUNA SWEDEN TEL: +46 8 580 881 00 FAX: +46 8 580 881 01

SAINT-GOBAIN INOVATIF MALZEMELER VE AŞINDIRICI SAN. TIC. A.Ş. GOLD PLAZA, ALTAY ÇEŞME MAHALLESI, ÖZ SOKAK, NO:19/16 34843 MALTEPE-ISTANBUL, TURKEY TEL: 0090-216-217 12 50 FAX: 0090-216-442 40 74

SAINT-GOBAIN ABRASIVES LTD. DOXEY RD STAFFORD ST16 1EA UNITED KINGDOM TEL: +44 1785 222 000 FAX: +44 1785 213 487 VERS. 2015.07.06



www.construction.norton.eu

Saint-Gobain Abrasives 190, Bd. J. F. Kennedy L-4930 BASCHARAGE LUXEMBOURG

Tel: ++352 50401-1 Fax: ++352 501633 e-mail: sales.nlx@saint-gobain.com